



November 8, 2016

Carla Watts
Carbondale New School
1302 East Pleasant Hill Road
Carbondale, IL 63902

Re: AHERA 3-Year Reinspection

Dear Ms. Watts:

Your school's most recent Asbestos 3-Year Reinspection has been completed as required. Two copies of the Report are being presented to the school for inclusion in your Asbestos Management Plan. One copy is to stay at the school main office and the other copy is to remain in the Superintendent's Office.

- The materials were found to be in good condition throughout the building. Continue to monitor the materials under Operations & Maintenance and report any change in condition immediately.

Upon completion of the Reinspection, the following action items were noted:

- *All materials that are to be impacted in any manner, rather maintenance or renovation or daily use, need to be sampled prior to impacting.*
- *Training records were missing from the Management Plan*
- *Six Month Surveillance records were missing from the Management Plan*

Reminders:


Please make sure that the required asbestos annual notification has been distributed to all building occupants regarding the availability of the Asbestos Management Plan. A copy of the Notification is required to be on file in the Asbestos Management Plan.

Please make sure that all outside contractors are signing the required work permits before completing work in the building.

As always, thank you for your cooperation in regards to your asbestos program. If we can be of any further assistance, please do not hesitate in contacting me at 618-656-6988 or wynter@farmerenv.com.

Respectfully submitted,

Wynter Farmer
Farmer Environmental Services, LLC

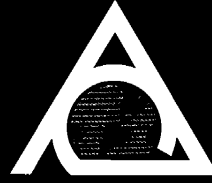

**Farmer
Environmental
Services, LLC**

AHERA THREE YEAR ASBESTOS REINSPECTION REPORT

Carbondale New School
ID #30-039-1400-004X
1302 East Pleasant Hill Road
Carbondale, Illinois 62902

Local Education Agency:
Carbondale New School
1302 East Pleasant Hill Road
Carbondale, Illinois 62902

Date of Reinspection: August 18, 2016

Project Number: 1608-452

TABLE OF CONTENTS

- A. Introduction
 - 1. General information
 - 2. Inspectors Responsibilities
 - 3. Previously Unidentified Suspect Asbestos Containing Building Materials
 - 4. Management Planner's Responsibilities
 - 5. Federal Requirements Under EPA NESHAP Regulations
 - 6. Comments

- B. Reinspection Summary
 - 1. LEA and Building Information
 - 2. AHERA Three Year Reinspection Information
 - 3. Sampling (Completed during Three Year Reinspection)
 - 4. Previously Unidentified Suspect Asbestos Containing Materials

- C. Summary of Findings

- D. Inspectors Assessment

- E. Management Planner Response Action Recommendations

- F. IDPH School Information Forms

- G. Licenses and Accreditations



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
School: Carbondale New School
Address: 1302 E. Pleasant Hill Rd. Carbondale,
IL 62902
Contact/Phone: Carla Watts/618-457-4765
FES# 1608-452
Date of Re-Inspection: August 18, 2016

A. INTRODUCTION

1.0 GENERAL INFORMATION

In accordance with the Environmental Protection Agency's (EPA's) Asbestos Hazard Emergency Response Act (AHERA) 40 CFR 763.85(b), at least once every three years from the implementation of a school's initial Asbestos Inspection and Management Plan, a Reinspection is required to be completed. The reinspection must be completed by an EPA/AHERA Accredited, Illinois Department of Public Health licensed asbestos inspector.

2.0 INSPECTOR RESPONSIBILITIES

- a. As part of the Reinspection, the inspector shall complete all requirements of AHERA Section 763.85(b) including:
- Visually reinspecting, and reassessing the condition of all friable known or assumed ACM.
 - Visually inspecting material that was previously considered non-friable ACM and touch the material to determine whether it has become friable since the last inspection or reinspection.
 - Identifying any homogeneous areas with material that has become friable since the last inspection or reinspection,
 - For each homogeneous area of newly friable material that is already assumed to be ACM, collect bulk samples and submit for analysis. Record exact locations where samples are collected and include name, accreditation number and signature of inspector.
 - Assessing the condition of the newly friable material in areas where samples are collected, and newly friable materials in areas that are assumed to be ACM
 - Reassessing the condition of friable known or assumed ACM previously identified
 - Submitting a copy of the Reinspection Report to the LEA and review findings with the Designated Person.
- b. This Reinspection report is intended to document the change in conditions of known or assumed ACM within the building(s) since the previous Three Year Reinspection. This report has been reviewed by the LEA and the Designated Person and they have been informed of the policies and procedures to be implemented with respect to any ACM known or assumed within this facility.
- c. The following AHERA Categories were used in determining the Inspectors Assessment / Reassessment of the known or assumed asbestos containing materials located in the building:
1. Damaged or Significantly Damaged thermal system insulation ACM
 2. Damaged friable surfacing ACM
 3. Significantly damaged friable surfacing ACM
 4. Damaged or significantly damaged friable miscellaneous ACM
 5. ACBM with potential for damage
 6. ACBM with potential for significant damage
 7. Any remaining friable ACBM or friable suspected ACBM
 8. N/A – Material is non-friable



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
School: Carbondale New School
Address: 1302 E. Pleasant Hill Rd. Carbondale,
IL 62902
Contact/Phone: Carla Watts/618-457-4765
FES# 1608-452
Date of Re-Inspection: August 18, 2016

3.0 PREVIOUSLY UNIDENTIFIED SUSPECT ASBESTOS CONTAINING MATERIALS

When applicable, the Management Plan(s) may not include suspect asbestos containing materials that have since been identified or have been identified during the Three Year Reinspection. These materials may include, interior boiler materials (fire brick, boiler linings), fire rated door linings, chalkboards and adhesives, wall base adhesives, floor tile mastics, gypsum board (tape and compounds), sheet flooring and adhesives, exterior walkways or porticos, etc. The previously unidentified materials are required to be properly identified, assessed, quantified, and implemented into the LEA's Management Plan. Unless otherwise sampled, these materials shall be assumed to contain asbestos until sampled and otherwise analyzed as no asbestos detected. This also applies to materials that are inaccessible and/or unforeseen during routine inspections. Although not required as part of the Three Year Reinspection, it is the LEA's Responsibility that these materials be included in the Management Plan.

1.0 MANAGEMENT PLANNER RESPONSIBILITIES

- a. Once the Reinspection has been completed by the inspector, an EPA/AHERA accredited, IDPH licensed Management Planner is required to review the inspectors findings and make any necessary revisions, if applicable, to response actions. A Response Action is defined as appropriate action that the LEA should take regarding a known or assumed asbestos containing material. Response Actions are required for all thermal system insulations and friable surfacing or miscellaneous materials that are located in a building.

5.0 FEDERAL REQUIREMENTS UNDER EPA NESHAP REGULATIONS

The asbestos National Emission Standards for Hazardous Air Pollutants" of NESHAP is a federal regulation promulgated by the US Environmental Protection Agency (EPA) that applies to schools and other facilities. In accordance with EPA NESHAP Requirements, an asbestos inspection is required prior to any building material that may be impacted prior to renovation or demolition activities. The inspection includes those materials not recognized under "Asbestos Containing Materials in Schools". Examples primarily include "exterior" building materials such as roofing materials, fascia/soffit materials, window caulking and/or glazing, door frame sealants, etc. These materials are to be assumed to contain asbestos until sampled and verified otherwise.

6.0 COMMENTS:

- a. This report constitutes the understanding between Farmer Environmental Services, LLC, the owner and/or owners representative as to the actual scope of the work completed. The findings and conclusions incorporated in this report are for informational purposes only. It is the responsibility of the owner, owners representative and/or those working under the jurisdiction of the owner or owners representative to abide by all governing rules and regulations in regards to additional asbestos related work that may be further completed (i.e. asbestos abatement, asbestos design, submittals and notifications, removal, disposal, means, methods, techniques, or work procedures that is above and beyond the inspection and sampling phases) completed by Farmer Environmental Services, LLC.
- b. This report is solely to be used for reference purposes only as to the identification, location, findings and recommendations and is not to be used for asbestos design purposes.



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
School: Carbondale New School
Address: 1302 E. Pleasant Hill Rd. Carbondale,
IL 62902
Contact/Phone: Carla Watts/618-457-4765
FES# 1608-452
Date of Re-Inspection: August 18, 2016

B. REINSPECTION SUMMARY

1. LEA AND BUILDING INFORMATION:

Building Name: Carbondale New School
1302 East Pleasant Hill Road
Carbondale, Illinois, 62902

IDPH Building ID #: 30-039-1400-004X

Local Education Agency: Carbondale New School
1302 East Pleasant Hill Road
Carbondale, Illinois, 63902

Administrator: Carla Watts
LEA Designated Person: Carla Watts

2. AHERA THREE YEAR REINSPECTION INFORMATION

Date of Reinspection: August 18, 2016

Inspector: Eric Colombo, IDPH License #:100-09404
Farmer Environmental Services, LLC
108 Emerald Hills
Edwardsville, Illinois 62025

Management Planner: Eric Colombo, IDPH License #:100-09404
Farmer Environmental Services, LLC
108 Emerald Hills
Edwardsville, Illinois 62025

3. SAMPLING: Number of samples collected during the Reinspection: 0



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

C. SUMMARY OF FINDINGS

(known or assumed asbestos containing materials located in the building)

Area ID	Description of Material	Location of Material	Quantity	Contains Asbestos (Yes / No / Assumed)	Comments:
CARBONDALE NEW SCHOOL – MAIN BUILDING					
01-001	DRYWALL – CEILINGS & WALLS (WHITE)	ROOMS 4-6, 9-16, 18-20, & 22	9, 852 SQ. FT.	NO 3 NAD	JOINT COMPOUND NOT SAMPLED OR ANALYZED. WILL ADD JOINT COMPOUND TO MANAGEMENT PLAN.
01-002	NOT USED				
01-003	LINOLEUM (GOLD PEBBLE)	ROOMS 5, 6, & 9	576 SQ. FT.	YES 1 ACM	LINOLEUM HAS BEEN REMOVED & REPLACED BY FLOOR TILE. CERAMIC TILE & ANOTHER LINOLEUM POSSIBLY COULD HAVE JUST BEEN COVERED UP.
01-004	12" X 12" FLOOR TILE (WHITE W/ BEIGE FLECK & WHITE W/ GREY FLECK)	ROOMS 11-12, & 19	454 SQ. FT.	ASSUMED (PLM WAS NAD)	RECOMMENDED TEM SAMPLE & ASSUMING MATERIAL IS ACM UNTIL TEM.
01-005	12" X 12" CEILING TILE UNIFORM HOLES (WHITE)	ROOM 15 (LUNCH ROOM CLOSET)	49 SQ. FT.	NO 3 NAD	CEILING TILE MASTIC ASSUMED (01-012)
01-006	12" X 12" FLOOR TILE (GREEN PEBBLE)	ROOM 17 (KITCHEN)	132 SQ. FT.	ASSUMED	
01-007	LINOLEUM ADHESIVE (UNKNOWN COLOR)	ROOMS 5, 6, & 9	576 SQ. FT.	ASSUMED	LINOLEUM REMOVED FROM ROOMS 5, 6, & 9 POSSIBLY JUST COVERED UP. ASSUMING THIS MASTIC REMAINS
01-008	FLOOR TILE ADHESIVE FOR 004 & 006 (UNKNOWN COLOR)	ROOMS 11, 12, 17, & 19	586 SQ. FT.	ASSUMED	
01-009	CARPET ADHESIVE (UNKNOWN COLOR)	ROOMS 9, 10, 11, 16, & 19	1, 462 SQ. FT.	ASSUMED	ORIGINAL MANAGEMENT PLAN CARPET REMOVED AT SOME TIME. MASTIC MAY STILL BE UNDER FLOOR TILE.
01-010	FIRE DOORS (UNKNOWN COLOR)	ALL DOORS	ALL DOORS	ASSUMED	
01-011	BASEBOARD ADHESIVE (UNKNOWN COLOR)	ROOMS 5 & 6	144 SQ. FT.	ASSUMED	COVE BASE REMOVED & REPLACED W/ DIFFERENT BASES.
01-012	CEILING TILE ADHESIVE FOR 01-005 (UNKNOWN COLOR)	ROOM 15 (LUNCH ROOM CLOSET)	49 SQ. FT.	ASSUMED	ASSUMED THIS MASTIC STILL REMAINS.



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

SUMMARY OF FINDINGS (cont)

(known or assumed asbestos containing materials located in the building)

Area ID	Description of Material	Location of Material	Quantity	Contains Asbestos (Yes / No / Assumed)	Comments:
MFA	12" X 12" FLOOR TILE (SALMON)	ROOM 16	160 SQ. FT.	ASSUMED	
MFA-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	ROOM 16	160 SQ. FT.	ASSUMED	
MFB	12" X 12" FLOOR TILE (WHITE W/ GREY FLECK)	ROOMS 4, 7, 8, 9, & 10	680 SQ. FT.	ASSUMED	
MFB-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	ROOMS 4, 7, 8, 9, & 10	680 SQ. FT.	ASSUMED	
MFC	SHEET FLOORING (WHITE)	ROOMS 5 & 6 ENTRIES	90 SQ. FT.	ASSUMED	
MFC-M	SHEET FLOORING ADHESIVE (UNKNOWN COLOR)	ROOMS 5 & 6 ENTRIES	90 SQ. FT.	ASSUMED	
MMA	CARPET ADHESIVE (UNKNOWN COLOR)	ROOMS 9 & 10	480 SQ. FT.	ASSUMED	
MMB	12" X 12" CERAMIC TILE (LIGHT GREY)	ROOMS 5 & 6	360 SQ. FT.	ASSUMED	
MMB-G	12" X 12" CERAMIC TILE GROUT (UNKNOWN COLOR)	ROOMS 5 & 6	360 SQ. FT.	ASSUMED	
MMB-M	12" X 12" CERAMIC TILE MORTAR (UNKNOWN COLOR)	ROOMS 5 & 6	360 SQ. FT.	ASSUMED	
MMC	6" COVE BASE (WHITE)	ROOMS 11 & 19	25 SQ. FT.	ASSUMED	
MMC-M	6" COVE BASE ADHESIVE (UNKNOWN COLOR)	ROOMS 11 & 19	25 SQ. FT.	ASSUMED	
MMD	4" COVE BASE (LIGHT GREY)	ROOMS 5 & 6 ENTRIES	18 SQ. FT.	ASSUMED	
MMD-M	4" COVE BASE ADHESIVE (UNKNOWN COLOR)	ROOMS 5 & 6 ENTRIES	18 SQ. FT.	ASSUMED	
MME	6" COVE BASE (LIGHT GREY)	ROOM 6	10 SQ. FT.	ASSUMED	
MME-M	6" COVE BASE ADHESIVE (UNKNOWN COLOR)	ROOM 6	10 SQ. FT.	ASSUMED	
MMF	4" COVE BASE (BLACK)	ROOMS 9 & 10	30 SQ. FT.	ASSUMED	
MMF-M	4" COVE BASE ADHESIVE (UNKNOWN COLOR)	ROOMS 9 & 10	30 SQ. FT.	ASSUMED	
MMG	CHALKBOARDS (GREEN/BLACK)	ROOMS 1 & 2	128 SQ. FT.	ASSUMED	
MMG-M	CHALKBOARD ADHESIVE (UNKNOWN COLOR)	ROOMS 1 & 2	128 SQ. FT.	ASSUMED	
MMH	INTERIOR WINDOW FRAME CAULK (GREY)	BASEMENT: ORIGINAL WINDOWS	8 SQ. FT.	ASSUMED	
MMI	INTERIOR WINDOW FRAME CAULK (WHITE)	BASEMENT: REPLACEMENT VINYL WINDOWS	6 SQ. FT.	ASSUMED	
MMJ	INTERIOR WINDOW FRAME CAULK (WHITE)	1 ST FLOOR WINDOWS	45 SQ. FT.	ASSUMED	



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

SUMMARY OF FINDINGS (cont)

(known or assumed asbestos containing materials located in the building)

Area ID	Description of Material	Location of Material	Quantity	Contains Asbestos (Yes / No / Assumed)	Comments:
MMK	INTERIOR DOOR FRAME CAULK (TAN)	ROOM SPACE DOORS	26 SQ. FT.	ASSUMED	
MML	INTERIOR DOOR FRAME CAULK (TAN)	BUILDING ENTRY/EXIT DOORS	8 SQ. FT.	ASSUMED	
MXA	JOINT COMPOUND (WHITE)	ROOMS 1-16, 19, & 22	9, 832 SQ. FT.	ASSUMED	
MMM	EXTERIOR WINDOW FRAME CAULK (GREY)	BASEMENT: ORIGINAL WINDOWS	8 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
MMN	EXTERIOR WINDOW GLAZING (GREY)	BASEMENT: ORIGINAL WINDOWS	16 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
MMO	EXTERIOR WINDOW FRAME CAULK (WHITE)	BASEMENT: REPLACEMENT VINYL WINDOWS	6 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
MMP	EXTERIOR WINDOW FRAME CAULK (WHITE)	1 ST FLOOR WINDOWS	45 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
MMQ	EXTERIOR WINDOW GLAZING (WHITE)	1 ST FLOOR WINDOWS	45 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
MMR	EXTERIOR DOOR FRAME CAULK (GREY)	BUILDING ENTRY/EXIT DOORS	8 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
MMS	ROOFING MATERIALS (GREY SHINGLE W/ BLACK)	ROOF	3, 600 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
CARBONDALE NEW SCHOOL - GAZEBO PLAYGROUND					
MMA	ROOFING MATERIALS (GREY SHINGLE BLACK)	GAZEBO ROOF	36 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
CARBONDALE NEW SCHOOL - PORTABLE CLASSROOM BUILDING					
SCA	CEILING TEXTURE MATERIAL FLUFFY/"POPCORN" (WHITE)	CEILINGS	1, 176 SQ. FT.	ASSUMED	
MFA	12" X 12" FLOOR TILE (LIGHT BLUE)	CLASSROOMS	410 SQ. FT.	ASSUMED	
MFA-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	CLASSROOMS	410 SQ. FT.	ASSUMED	
MFB	12" X 12" FLOOR TILE (MEDIUM BLUE)	CLASSROOMS	24 SQ. FT.	ASSUMED	
MFB-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	CLASSROOMS	24 SQ. FT.	ASSUMED	
MFC	12" X 12" FLOOR TILE (WHITE W/ BLUE FLECK)	CLASSROOMS	640 SQ. FT.	ASSUMED	
MFC-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	CLASSROOMS	640 SQ. FT.	ASSUMED	



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

INSPECTORS ASSESSMENT

(known or assumed asbestos containing materials located in the building)

Area ID	Description of Material	Friable	Condition	Inspectors Assessment Number	CHANGE IN CONDITION (Y/ N) TYPE OF CHANGE OR NEW MATERIAL
CARBONDALE NEW SCHOOL – PORTABLE CLASSROOM BUILDING					
SCA	CEILING TEXTURE MATERIAL FLUFFY/"POPCORN" (WHITE)	YES	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFA	12" X 12" FLOOR TILE (LIGHT BLUE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFA-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFB	12" X 12" FLOOR TILE (MEDIUM BLUE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFB-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFC	12" X 12" FLOOR TILE (WHITE W/ BLUE FLECK)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFC-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFD	12" X 12" FLOOR TILE (TAN)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFD-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMA	4" COVE BASE (DARK BROWN)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMA-M	4" COVE BASE MASTIC (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMB	INTERIOR WINDOW FRAME CAULK (WHITE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMC	INTERIOR DOOR FRAME CAULK (WHITE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMD	INTERIOR DOOR FRAME CAULK (WHITE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MWA	DRYWALL	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MXA	JOINT COMPOUND	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MME	EXTERIOR WINDOW FRAME CAULK (WHITE)	NO	NO DAMAGE	5	NESHAPS
MMF	EXTERIOR WINDOW FRAME GLAZING (WHITE)	NO	NO DAMAGE	5	NESHAPS
MMG	EXTERIOR DOOR FRAME CAULK (WHITE)	NO	NO DAMAGE	5	NESHAPS
MMH	ROOFING MATERIALS (BLACK)	NO	NO DAMAGE	5	NESHAPS



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
School: Carbondale New School
Address: 1302 E. Pleasant Hill Rd. Carbondale,
IL 62902
Contact/Phone: Carla Watts/618-457-4765
FES# 1608-452
Date of Re-Inspection: August 18, 2016

MATERIAL CONDITION:

No Damage (Good) - the material is in overall good condition with minor damage present.
Damaged - the material contains less than 10% distributed 25% localized damage.
Significant Damaged - the material contains more than 10% distributed or 25% localized damage.

INSPECTORS ASSESSMENT NUMBER

1. Damaged or Significantly Damaged thermal system insulation
2. Damaged friable surfacing ACM
3. Significantly damaged friable surfacing ACM
4. Damaged or significantly damaged friable miscellaneous ACM
5. ACBM with potential for damage
6. ACBM with potential for significant damage
7. Any remaining friable ACBM or friable suspected ACBM

A handwritten signature in cursive script that reads "Eric Colombo".

Eric Colombo, Inspector, IDPH ID #100-09404

11/9/16
Date:



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

D. INSPECTORS ASSESSMENT

(known or assumed asbestos containing materials located in the building)

Area ID	Description of Material	Friable	Condition	Inspectors Assessment Number	CHANGE IN CONDITION (Y/N) TYPE OF CHANGE OR NEW MATERIAL
CARBONDALE NEW SCHOOL – MAIN BUILDING					
01-003	LINOLEUM (GOLD PEBBLE)	YES	NO DAMAGE	5	NO CHANGE CONTINUE O & M
01-004	12" X 12" FLOOR TILE (WHITE W/ BEIGE FLECK & WHITE W/ GREY FLECK)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
01-006	12" X 12" FLOOR TILE (GREEN PEBBLE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
01-007	LINOLEUM ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
01-008	FLOOR TILE ADHESIVE FOR 004 & 006 (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
01-009	CARPET ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
01-010	FIRE DOORS (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
01-011	BASEBOARD ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
01-012	CEILING TILE ADHESIVE FOR 01-005 (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFA	12" X 12" FLOOR TILE (SALMON)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFA-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFB	12" X 12" FLOOR TILE (WHITE W/ GREY FLECK)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFB-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFC	SHEET FLOORING (WHITE)	YES	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MFC-M	SHEET FLOORING ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMA	CARPET ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMB	12" X 12" CERAMIC TILE (LIGHT GREY)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMB-G	12" X 12" CERAMIC TILE GROUT (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMB-M	12" X 12" CERAMIC TILE MORTAR (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMC	6" COVE BASE (WHITE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMC-M	6" COVE BASE ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

INSPECTORS ASSESSMENT

(known or assumed asbestos containing materials located in the building)

Area ID	Description of Material	Friable	Condition	Inspectors Assessment Number	CHANGE IN CONDITION (Y/N) TYPE OF CHANGE OR NEW MATERIAL
MMD	4" COVE BASE (LIGHT GREY)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMD-M	4" COVE BASE ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MME	6" COVE BASE (LIGHT GREY)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MME-M	6" COVE BASE ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMF	4" COVE BASE (BLACK)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMF-M	4" COVE BASE ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMG	CHALKBOARDS (GREEN/BLACK)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMG-M	CHALKBOARD ADHESIVE (UNKNOWN COLOR)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMH	INTERIOR WINDOW FRAME CAULK (GREY)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMI	INTERIOR WINDOW FRAME CAULK (WHITE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMJ	INTERIOR WINDOW FRAME CAULK (WHITE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMK	INTERIOR DOOR FRAME CAULK (TAN)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MML	INTERIOR DOOR FRAME CAULK (TAN)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MXA	JOINT COMPOUND (WHITE)	NO	NO DAMAGE	5	NO CHANGE CONTINUE O & M
MMM	EXTERIOR WINDOW FRAME CAULK (GREY)	NO	NO DAMAGE	5	NESHAPS
MMN	EXTERIOR WINDOW GLAZING (GREY)	NO	NO DAMAGE	5	NESHAPS
MMO	EXTERIOR WINDOW FRAME CAULK (WHITE)	NO	NO DAMAGE	5	NESHAPS
MMP	EXTERIOR WINDOW FRAME CAULK (WHITE)	NO	NO DAMAGE	5	NESHAPS
MMQ	EXTERIOR WINDOW GLAZING (WHITE)	NO	NO DAMAGE	5	NESHAPS
MMR	EXTERIOR DOOR FRAME CAULK (GREY)	NO	NO DAMAGE	5	NESHAPS
MMS	ROOFING MATERIALS (GREY SHINGLE W/ BLACK)	NO	NO DAMAGE	5	NESHAPS
CARBONDALE NEW SCHOOL - GAZEBO PLAYGROUND					
MMA	ROOFING MATERIALS (GREY SHINGLE BLACK)	NO	NO DAMAGE	5	NESHAPS



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

SUMMARY OF FINDINGS (cont)

(known or assumed asbestos containing materials located in the building)

Area ID	Description of Material	Location of Material	Quantity	Contains Asbestos (Yes / No / Assumed)	Comments:
MFD	12" X 12" FLOOR TILE (TAN)	LOBBY & RESTROOMS	156 SQ. FT.	ASSUMED	
MFD-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	LOBBY & RESTROOMS	156 SQ. FT.	ASSUMED	
MMA	4" COVE BASE (DARK BROWN)	ALL ROOMS	70 SQ. FT.	ASSUMED	
MMA-M	4" COVE BASE MASTIC (UNKNOWN COLOR)	ALL ROOMS	70 SQ. FT.	ASSUMED	
MMB	INTERIOR WINDOW FRAME CAULK (WHITE)	WINDOWS	8 SQ. FT.	ASSUMED	
MMC	INTERIOR DOOR FRAME CAULK (WHITE)	ROOM SPACE DOORS	6 SQ. FT.	ASSUMED	
MMD	INTERIOR DOOR FRAME CAULK (WHITE)	BUILDING ENTRY/EXIT DOORS	4 SQ. FT.	ASSUMED	
MWA	DRYWALL	ALL WALLS & CEILINGS	3, 500 SQ. FT.	ASSUMED	
MXA	JOINT COMPOUND	ALL WALLS & CEILINGS	3, 500 SQ. FT.	ASSUMED	
MME	EXTERIOR WINDOW FRAME CAULK (WHITE)	WINDOWS	8 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
MMF	EXTERIOR WINDOW FRAME GLAZING (WHITE)	WINDOWS	12 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
MMG	EXTERIOR DOOR FRAME CAULK (WHITE)	BUILDING ENTRY/EXIT DOORS	4 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL
MMH	ROOFING MATERIALS (BLACK)	ROOF	1, 200 SQ. FT.	ASSUMED	NESHAPS REGULATED MATERIAL



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

MANAGEMENT PLANNER RESPONSE ACTION RECOMMENDATIONS (cont)

Area ID	Description of Material	Hazard Potential Classification	RESPONSE ACTION RECOMMENDATION (See attached Response Action Recommendations)	Estimated cost / Schedule
MMB	12" X 12" CERAMIC TILE (LIGHT GREY)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMB-G	12" X 12" CERAMIC TILE GROUT (UNKNOWN COLOR)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMB-M	12" X 12" CERAMIC TILE MORTAR (UNKNOWN COLOR)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMC	6" COVE BASE (WHITE)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMC-M	6" COVE BASE ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMD	4" COVE BASE (LIGHT GREY)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMD-M	4" COVE BASE ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MME	6" COVE BASE (LIGHT GREY)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MME-M	6" COVE BASE ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMF	4" COVE BASE (BLACK)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMF-M	4" COVE BASE ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMG	CHALKBOARDS (GREEN/BLACK)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMG-M	CHALKBOARD ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMH	INTERIOR WINDOW FRAME CAULK (GREY)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMI	INTERIOR WINDOW FRAME CAULK (WHITE)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMJ	INTERIOR WINDOW FRAME CAULK (WHITE)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMK	INTERIOR DOOR FRAME CAULK (TAN)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

MANAGEMENT PLANNER RESPONSE ACTION RECOMMENDATIONS (cont)

Area ID	Description of Material	Hazard Potential Classification	RESPONSE ACTION RECOMMENDATION (See attached Response Action Recommendations)	Estimated cost / Schedule
MML	INTERIOR DOOR FRAME CAULK (TAN)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MXA	JOINT COMPOUND (WHITE)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMM	EXTERIOR WINDOW FRAME CAULK (GREY)	N/A	NESHAPS REGULATED MATERIAL	
MMN	EXTERIOR WINDOW GLAZING (GREY)	N/A	NESHAPS REGULATED MATERIAL	
MMO	EXTERIOR WINDOW FRAME CAULK (WHITE)	N/A	NESHAPS REGULATED MATERIAL	
MMP	EXTERIOR WINDOW FRAME CAULK (WHITE)	N/A	NESHAPS REGULATED MATERIAL	
MMQ	EXTERIOR WINDOW GLAZING (WHITE)	N/A	NESHAPS REGULATED MATERIAL	
MMR	EXTERIOR DOOR FRAME CAULK (GREY)	N/A	NESHAPS REGULATED MATERIAL	
MMS	ROOFING MATERIALS (GREY SHINGLE W/ BLACK)	N/A	NESHAPS REGULATED MATERIAL	
CARBONDALE NEW SCHOOL - GAZEBO PLAYGROUND				
MMA	ROOFING MATERIALS (GREY SHINGLE BLACK)	N/A	NESHAPS REGULATED MATERIAL	
CARBONDALE NEW SCHOOL – PORTABLE CLASSROOM BUILDING				
SCA	CEILING TEXTURE MATERIAL FLUFFY/"POPCORN" (WHITE)	6	7. <u>NO DAMAGE</u> - Maintain friable materials in good condition and continue under O & M program until hazard assessment factors change.	
MFA	12" X 12" FLOOR TILE (LIGHT BLUE)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFA-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFB	12" X 12" FLOOR TILE (MEDIUM BLUE)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFB-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFC	12" X 12" FLOOR TILE (WHITE W/ BLUE FLECK)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES#: 1608-452
 Date of Re-Inspection: August 18, 2016

MANAGEMENT PLANNER RESPONSE ACTION RECOMMENDATIONS (cont)

Area ID	Description of Material	Hazard Potential Classification	RESPONSE ACTION RECOMMENDATION (See attached Response Action Recommendations)	Estimated cost / Schedule
MFC-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFD	12" X 12" FLOOR TILE (TAN)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFD-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMA	4" COVE BASE (DARK BROWN)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMA-M	4" COVE BASE MASTIC (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMB	INTERIOR WINDOW FRAME CAULK (WHITE)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMC	INTERIOR DOOR FRAME CAULK (WHITE)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMD	INTERIOR DOOR FRAME CAULK (WHITE)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MWA	DRYWALL	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MXA	JOINT COMPOUND	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MME	EXTERIOR WINDOW FRAME CAULK (WHITE)	N/A	NESHAPS REGULATED MATERIAL	
MMF	EXTERIOR WINDOW FRAME GLAZING (WHITE)	N/A	NESHAPS REGULATED MATERIAL	
MMG	EXTERIOR DOOR FRAME CAULK (WHITE)	N/A	NESHAPS REGULATED MATERIAL	
MMH	ROOFING MATERIALS (BLACK)	N/A	NESHAPS REGULATED MATERIAL	

HAZARD POTENTIAL CLASSIFICATION		
Rank	ACBM Condition	ACBM Disturbance Potential
1	Significantly Damaged	Any
2	Damaged	Potential for Significant Damage
3	Damaged	Potential for Damage
4	Damaged	Low
5	Good	Potential for Significant Damage
6	Good	Potential for Damage
7	Good	Low

NOTE:
 In accordance with AHERA Rules and Regulations, all Thermal System Insulation shall be in an intact and undamaged condition.

Eric Colombo

Eric Colombo, Management Planner, IDPH ID #100-09404

11/9/16

Date:



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
School: Carbondale New School
Address: 1302 E. Pleasant Hill Rd. Carbondale,
IL 62902
Contact/Phone: Carla Watts/618-457-4765
FES# 1608-452
Date of Re-Inspection: August 18, 2016

MANAGEMENT PLANNER RESPONSE ACTION RECOMMENDATIONS (Response Action Hazard Ranking)

1. SIGNIFICANTLY DAMAGED THERMAL SYSTEM INSULATION(S) – Immediately isolate the functional space(s) where significant damage is present and restrict access to protect human health and environment. At least repair damaged area(s) to maintain coverings in an intact state and undamaged condition. Remove damaged material, if not feasible due to factors to repair the damage.
1. SIGNIFICANTLY DAMAGED SURFACING and MISCELLANEOUS MATERIAL(S) – Immediately isolate the functional space(s) and restrict access. Remove damaged materials unless other means are sufficient to contain fibers (enclosure or encapsulation).
2. DAMAGED SURFACING or MISCELLANEOUS MATERIALS - Isolate the functional space(s) until further Response Action is completed (repair, removal, enclosure, encapsulation). Take preventive measures to reduce potential for significant damage.
3. DAMAGE MATERIAL (with potential for Significant Damage) – Repair, remove, enclose or encapsulate damaged material. Institute preventive measures to eliminate likelihood that material will be significantly damaged, deteriorated, or delaminated.
4. DAMAGED MATERIAL (with Potential for Damage) - Take preventive measures to reduce potential for damage (repair, removal, enclosure, encapsulation). Institute preventive measures to eliminate likelihood that material will be significantly damaged, deteriorated, or delaminated.
5. NO DAMAGE - Take preventive measures to reduce disturbance and potential for damage.
6. NO DAMAGE - Take preventive measures to reduce disturbance and potential for significant damage.
7. NO DAMAGE - Maintain friable materials in good condition and continue under O & M program until hazard assessment factors change.
8. NON-FRIABLE MATERIAL – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.

NOTE: Repair and/or removal of ACM is required to be completed by licensed personnel.



Farmer
Environmental
Services, LLC

AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
School: Carbondale New School
Address: 1302 E. Pleasant Hill Rd. Carbondale,
IL 62902
Contact/Phone: Carla Watts/618-457-4765
FES# 1608-452
Date of Re-Inspection: August 18, 2016

F. IDPH SCHOOL INFORMATION FORMS

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

SCHOOL_NAME: CARBONDALE NEW SCHOOL
SCHOOL ID NUMBER: 30-039-1400-004X
ADDRESS: 1302 E. PLEASANT HILL ROAD
CITY: CARBONDALE IL 62902

LAST REINSPECTION DATE: 8/27/2013

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR CURRENT THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 8/18/16 ENROLLMENT 45
IDPH LICENSED INSPECTOR NAME: Eric Colombo
IDPH LICENSE #: 100-09404
IDPH LICENSED MANAGEMENT PLANNER NAME: Eric Colombo
IDPH LICENSE #: 100-09404

DESIGNATED PERSON: Carla Watts PHONE: _____
Carla D. Watts, assoc. director 99-16
Signature of Designated Person Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____
School has been closed. Date closed: _____
School building has been demolished. Date: _____
School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Other (explain): _____



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
School: Carbondale New School
Address: 1302 E. Pleasant Hill Rd. Carbondale,
IL 62902
Contact/Phone: Carla Watts/618-457-4765
FES# 1608-452
Date of Re-Inspection: August 18, 2016

G. LICENSES AND ACCREDITATIONS

ACCREDITATION OF BUILDING INSPECTOR

I certify that I conducted the required AHERA Three Year Reinspection for the building included within this report. Furthermore, I have examined the condition of each known or assumed Asbestos Containing Material within the building and have determined whether the material has changed since the last Reinspection. When applicable, I have reassessed the condition of each material and have reviewed the findings of the reinspection with a licensed Management Planner.

Inspector:

Eric Colombo, IDPH License #100-09404

ACCREDITATION OF MANAGEMENT PLANNER

I certify that I have reviewed the results of the inspectors findings and have revised any response actions necessary to update revisions were necessary. Furthermore, where applicable, I have made necessary amendments to the Management Plan and have included such amendments in this Reinspection Report.

Management Planner:

Eric Colombo, IDPH License #100-09404

DESIGNATED PERSON COMPLIANCE STATEMENT

I here-by certify that the AHERA Three Year Reinspection was conducted in accordance with AHERA Rules and Regulations (763.85).

LEA Designated Person: _____



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

ERIC C COLOMBO
108 EMERALD HILLS DRIVE
EDWARDSVILLE, IL 62025

6/1/2016




ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 09404

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License


Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
			INSPECTOR	5/5/2017
ID NUMBER	ISSUED	EXPIRES	MANAGEMENT PLANNER	5/5/2017
100 - 09404	6/1/2016	05/15/2017	PROJECT MANAGER	10/30/2016
ERIC C COLOMBO 108 EMERALD HILLS DRIVE EDWARDSVILLE, IL 62025 Environmental Health			AIR SAMPLING PROFESSIONAL	
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	
				

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

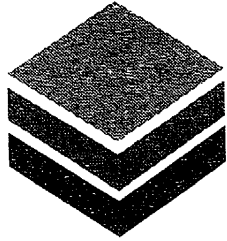

M·E·T·A
 Mayhew Environmental Training Associates
 I N C O R P O R A T E D


Certificate # ME084A12D39322409

Eric Colombo

has on 5/5/2016, in Hazelwood, MO
 completed the requirements for asbestos accreditation under Section 206 of TSCA Title II, 15 USC 2646

4-hr. Asbestos Building Inspector Refresher

as approved by the IDPH and the US EPA under 40 CFR 763 (AHERA)
 from 5/5/2016 to 5/5/2016 and passed the associated exam on 5/5/2016
 with a score of at least 70%

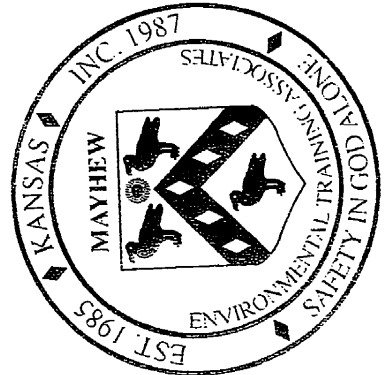


Thomas Brennan

Tom Brennan
 Instructor

Thomas Mayhew

Thomas Mayhew
 President

SSN: XXX-XX-3637
 Expiration: 5/5/2017
 P.O. Box 4693 - Lawrence, KS. 66047 - 800.444.6382
www.metaenvironmental.net

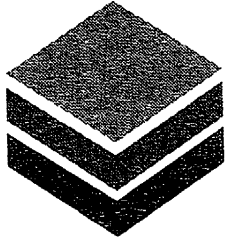

M·E·T·A
Mayhew Environmental Training Associates
I N C O R P O R A T E D


Certificate # ME3E47DDA877464DE

Eric Colombo

has on 5/5/2016, in Hazelwood, MO
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II, 15 USC 2646

4-hr. Asbestos Management Planner Refresher

as approved by the IDPH and the US EPA under 40 CFR 763 (AHERA)
from 5/5/2016 to 5/5/2016 and passed the associated exam on 5/5/2016
with a score of at least 70%

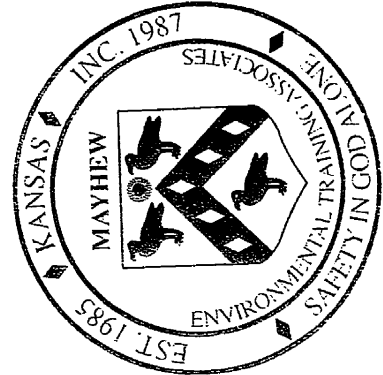

Tom Brennan

Tom Brennan
Instructor

Thomas Mayhew

Thomas Mayhew
President

SSN: XXX-XX-3637
Expiration: 5/5/2017
P.O. Box 4693 - Lawrence, KS. 66047 - 800.444.6382
www.metaenvironmental.net



AHERA THREE YEAR REINSPECTION

LEA: Carbondale New School
 School: Carbondale New School
 Address: 1302 E. Pleasant Hill Rd. Carbondale, IL 62902
 Contact/Phone: Carla Watts/618-457-4765
 FES# 1608-452
 Date of Re-Inspection: August 18, 2016

E. MANAGEMENT PLANNER RESPONSE ACTION RECOMMENDATIONS

Area ID	Description of Material	Hazard Potential Classification	RESPONSE ACTION RECOMMENDATION (See attached Response Action Recommendations)	Estimated cost / Schedule
CARBONDALE NEW SCHOOL – MAIN BUILDING				
01-003	LINOLEUM (GOLD PEBBLE)	6	7. <u>NO DAMAGE</u> - Maintain friable materials in good condition and continue under O & M program until hazard assessment factors change.	
01-004	12" X 12" FLOOR TILE (WHITE W/ BEIGE FLECK & WHITE W/ GREY FLECK)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
01-006	12" X 12" FLOOR TILE (GREEN PEBBLE)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
01-007	LINOLEUM ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
01-008	FLOOR TILE ADHESIVE FOR 004 & 006 (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
01-009	CARPET ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
01-010	FIRE DOORS (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
01-011	BASEBOARD ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
01-012	CEILING TILE ADHESIVE FOR 01-005 (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFA	12" X 12" FLOOR TILE (SALMON)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFA-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFB	12" X 12" FLOOR TILE (WHITE W/ GREY FLECK)	6	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFB-M	12" X 12" FLOOR TILE MASTIC (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MFC	SHEET FLOORING (WHITE)	6	7. <u>NO DAMAGE</u> - Maintain friable materials in good condition and continue under O & M program until hazard assessment factors change.	
MFC-M	SHEET FLOORING ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	
MMA	CARPET ADHESIVE (UNKNOWN COLOR)	7	8 <u>NON-FRIABLE MATERIAL</u> – Maintain material(s) in good condition and continue O & M Program until hazard assessment factors change.	